

Model: VERBIER DARK 45X120(A)


Codes: 100277986

Water absorption: BIII - Cladding Tile ($10.0\% < w_a \leq 20.0\%$)

Finish: Glazed / Standard

Tone variations: V3

Rectified: Yes

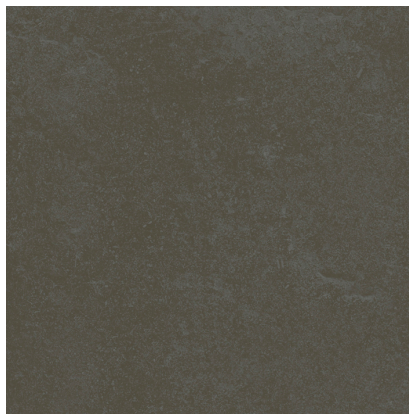

DIMENSIONAL FEATURES

UNE-EN ISO 10545-2

Thickness	10 mm	+/-5%*
Width	450 mm	
Length	1200 mm	
Length and width deviation	Below 0.15%	+/-0.3%*
Side straightness deviation	Below 0.15%	+/-0.3%*
Squareness deviation	Below 0.15%	+/-0.3%*
Surface flatness deviation	Below 0.15%	+/-0.4%*

*ISO-13006:2018 UNE-EN 14411:2016

FEATURES



Natural-looking, non-glossy surface finish.



Name given to the finish of those tiles dimensionally improved after the firing process.



Wall installation

MECHANICAL FEATURES

UNE-EN ISO 10545-4-6-7-9-11

Breaking strength	>600 N	>600 N*
Modulus of rupture	>15 N/mm ²	>=12 N/mm ² *
Crazing resistance	PASS	
Resistance to thermal shock	RESISTE	

*ISO-13006:2018 UNE-EN 14411:2016

HYGIENIC FEATURES

UNE-EN ISO 10545-13-14

Chemical resistance	Class "A" for swimming pools and cleaning products (resists attack). Minimum Class "B" for acids and bases	B Min.*
Stain resistance	Class 5. Easy cleaning with water	3 Min.*

*ISO-13006:2018 UNE-EN 14411:2016

ANTI-SLIP VALUE

Reference standards: EN 16165 (Annex A, B, C) - ANSI A326.3 - AS 4586

Dynamic coefficient of friction (dcof)	No Aplica	
--	-----------	--

*ISO-13006:2018 UNE 14411:2016 ANSI 137.1 AS 4662

System Certification



Do not use cleaning agents containing hydrofluoric acid.

It is recommended to fix tiles with a minimum joint of 1,5 mm. Do not fix without joint.

For big sizes, it is recommended to fix with mortars containing polymeric additives and to use the double gluing technique.

Mosaic tiles must be grouted.

This document is only commercial and cannot be used as expert opinion, documentary evidence or in any legal or administrative procedure unless authorized by PORCELANOSA S.A.

DETERMINATION OF LIGHT REFLECTANCE VALUE (LRV) UNE-EN ISO 10545-18

Determination of light reflectance value (Irv)

6.82

*ISO-13006:2018 UNE-EN 14411:2016

PACKING

Sales units per box

1.619958 M2/BOX

Sales units per pallet

64.798315 M2/PAL

Sales units per unit

0.539986 M2/PIECE

SCOPE OF USE

Technical code-1

1 - Use on walls

System Certification



Do not use cleaning agents containing hydrofluoric acid.

It is recommended to fix tiles with a minimum joint of 1,5 mm. Do not fix without joint.

For big sizes, it is recommended to fix with mortars containing polymeric additives and to use the double glueing technique.

Mosaic tiles must be grouted.

This document is only commercial and cannot be used as expert opinion, documentary evidence or in any legal or administrative procedure unless authorized by PORCELANOSA S.A.